

## FIELD INSPECTION

<b>Project Name:</b>	Mountain Valley Pipeline	<b>Inspector:</b>	Matthew Grant
<b>Inspection Date:</b>	Wednesday, January 30, 2019	<b>Project Contact:</b>	Brian Clauto
<b>Spread:</b> Franklin County MP 282 St14915+00-14900+00 Pittsylvania County MP 290 St15350-15338, MP 293 St15494+80-15458	Spread I	Weather (Wet/Dry/Rain):	Dry

**STAGE OF CONSTRUCTION:** (Check all that apply)

- ☐ Clearing
 ☐ Rough Grading
 ☐ Trench Excavation
 ☒ Pipe Assembly, Testing & Installation
- ☒ Backfilling and Grade Restoration
 ☐ Final Grading & Stabilization
 ☐ Other:

- |   |   | Yes                      | No                                  | N/A                      |
|---|---|--------------------------|-------------------------------------|--------------------------|
| 1 | Are controls installed and implemented in accordance with the approved erosion and sediment control plan and stormwater management plans?                                       | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| 2 | Are all control measures properly maintained in effective operating condition in accordance with good engineering practices and, where applicable, manufacturer specifications? | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| 3 | Areas of offsite sediment deposition were observed?   | <input type="checkbox"/> | <input checked="" type="checkbox"/> | <input type="checkbox"/> |

**Comments:**

- Streams / wetlands inspected included W-H5, S-H13, S-G16, S-DD3
- Stockpile near St#15344+00 requires additional stabilization.
- ROW requires additional stabilization near St#15338+00.
- Plunge pool requires maintenance at St#15338+50.
- CFS near plunge pool requires maintenance at St#15338+70.
- ROW and stockpiles near St#14915+00 require additional stabilization.
- Waterbar requires maintenance at St#14916+00.
- CFS at S-G16 buffer area is torn and requires maintenance.
- Blanket matting on side slope near St#14909+00 requires maintenance.
- Plunge pool near St#14904+50 requires maintenance.
- Waterbars exceed 5% between 14902+00 and 14906+00.

**Recommended Corrective Action:** Maintain and install all controls per the approved plan and specs.

**Deadline:** Within 24hr notification

The recommended corrective action deadline date applies to all conditions noted on this report unless otherwise noted. If listed condition(s) currently constitute non-compliance and/or corrective actions are not completed by the deadline, other enforcement actions may be issued to the entity responsible for ensuring compliance on the above project.


Inspector Signature: Matthew Grant Date: 2-12-19

## FIELD INSPECTION PHOTO LOG

Project Name: Mountain Valley Pipeline

Date: Wednesday, January 30, 2019

- Fig. 1 Stockpile near St#15344+00 requires additional stabilization

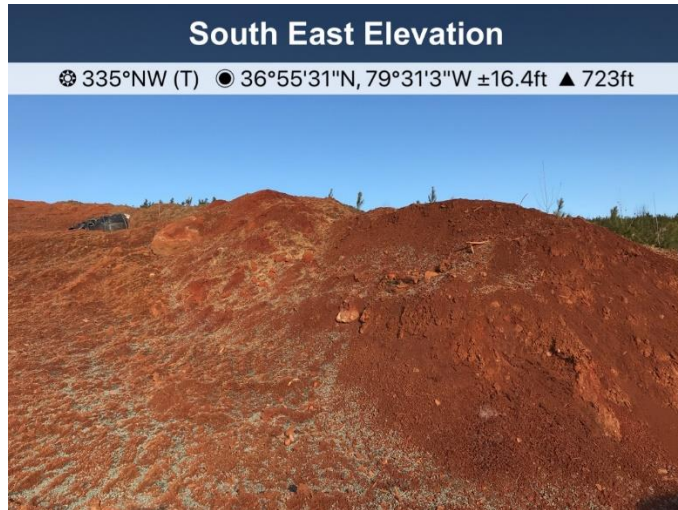

- Fig. 2 Plunge pool requires maintenance at St#15338+50



- Fig. 3 ROW and stockpiles near St#14915+00 require additional stabilization.



- Fig. 4 Waterbar requires maintenance at St#14916+00.



## FIELD INSPECTION PHOTO LOG



Project Name: Mountain Valley Pipeline

Date: Wednesday, January 30, 2019

- Fig. 5 CFS at S-G16 buffer area is torn and requires maintenance.



- Fig 6 Waterbars exceed 5% between 14902+00 and 14906+00.



- Fig. 7 Blanket matting on side slope near St#14909+00 requires maintenance.



- Fig. 8 Waterbars exceed 5% between 14902+00 and 14906+00.

